




PHOTO

DESCRIPTION


Level:	LGF
Window number:	11
Description:	3/3 sliding sash
Provenance:	Probably 19 th Century, lower sash and cill have been replaced with different profile
Condition:	Poor

REPAIRS PROPOSED

Replace parts:	Lower sash (1) Cill (2) 2 no. weight boards (3)
Replace glass:	3. no panes of lower sash (4)
Timber repair:	Apply proprietary epoxy resin filler as required
Overhaul:	Disassemble as necessary, service opening mechanism, reassemble so as to open freely Remove 2 no. opening restrictor blocks (5)
Putty:	Rake out substandard putty and replace with proprietary putty replacement sealant
Ironmongery:	Retain existing Add proprietary opening restrictor with key release
Decoration:	Sand to stable surface, repaint with primer/undercoat and top coat, paint to overlap slightly on to glass
Perimeter seal:	Apply proprietary oil-based mastic sealant

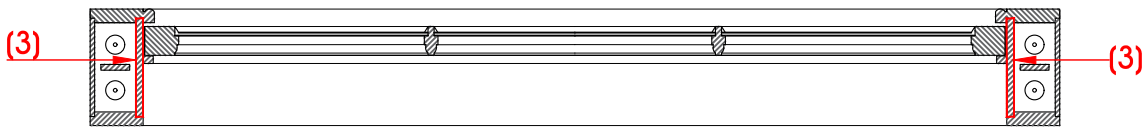


SECTION S3-S3

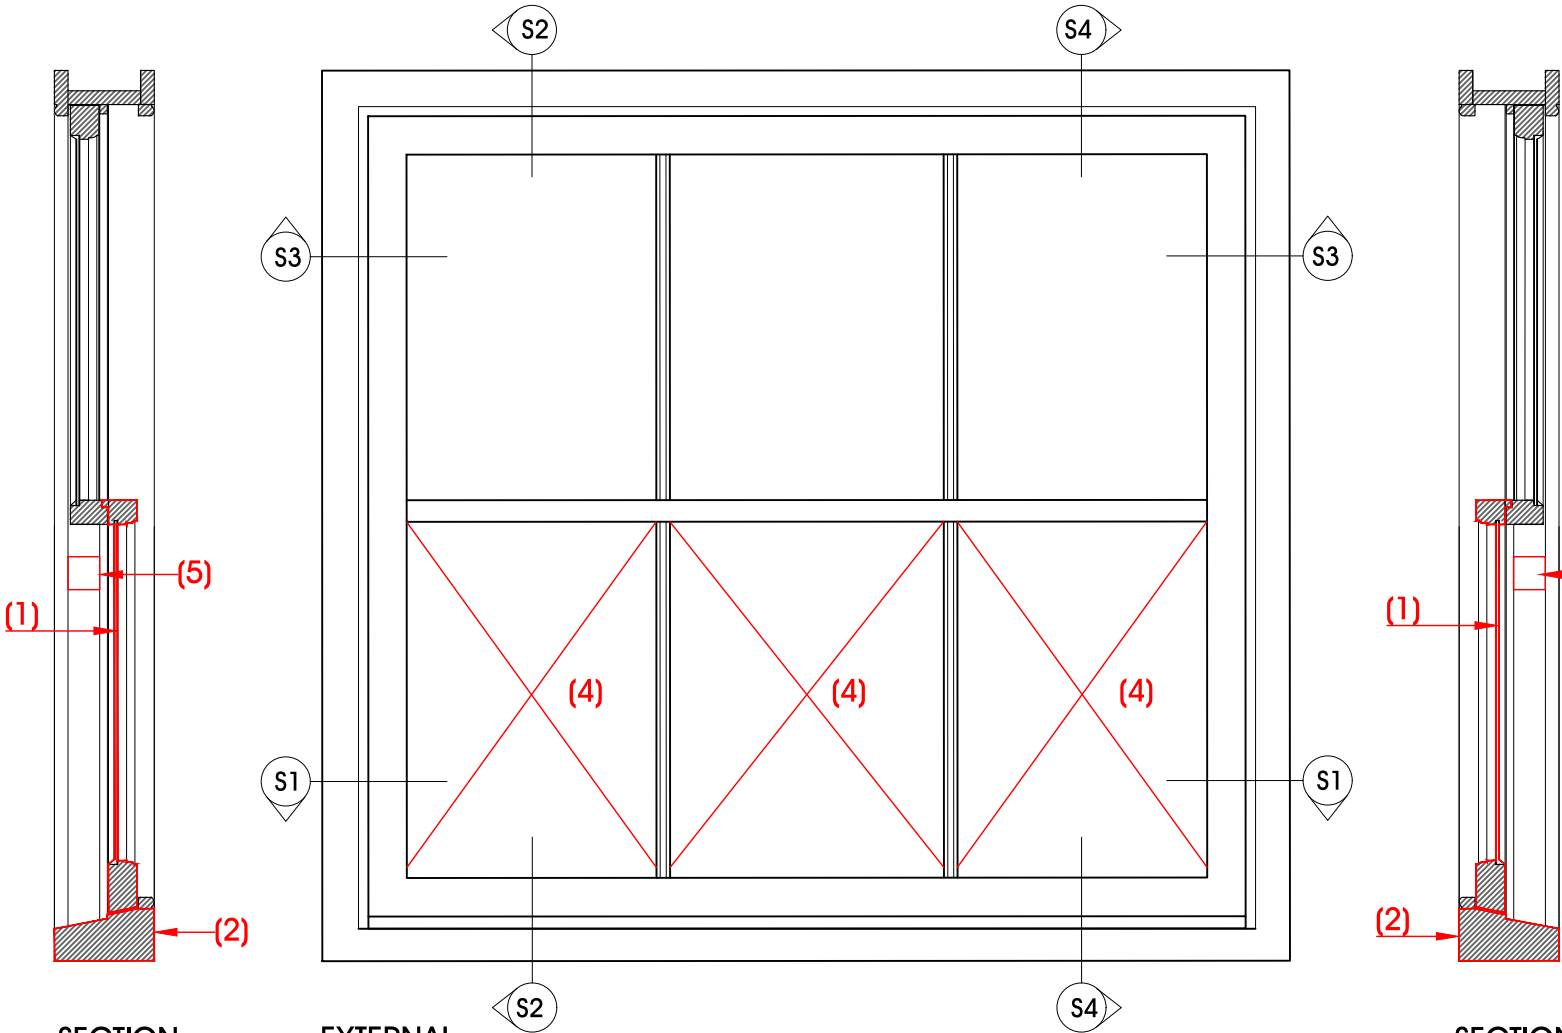

SECTION S2-S2


EXTERNAL ELEVATION

SECTION S4-S4

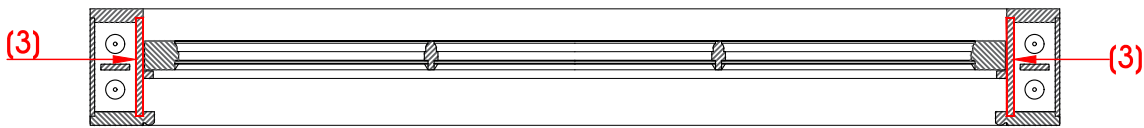

SECTION S1-S1

Drawings are illustrative only, for the purpose of identifying repairs.

 

Rev	Description	Date	DB
-----	-------------	------	----

Repton School
Window Repairs to
Rear (South) Elevation
of Foremark Hall
Milton

Window 11

Scale: 1:10 @ A3
Date: January 2026
Drawn By: CP Checked By:
Drawing No. 2025-860-11



urban designs limited
suite 6 | anson court
horninglow street
burton upon trent
staffordshire
de14 1ng
t: 01283 763763
e: info@urban-designs.co.uk
w: www.urban-designs.co.uk