




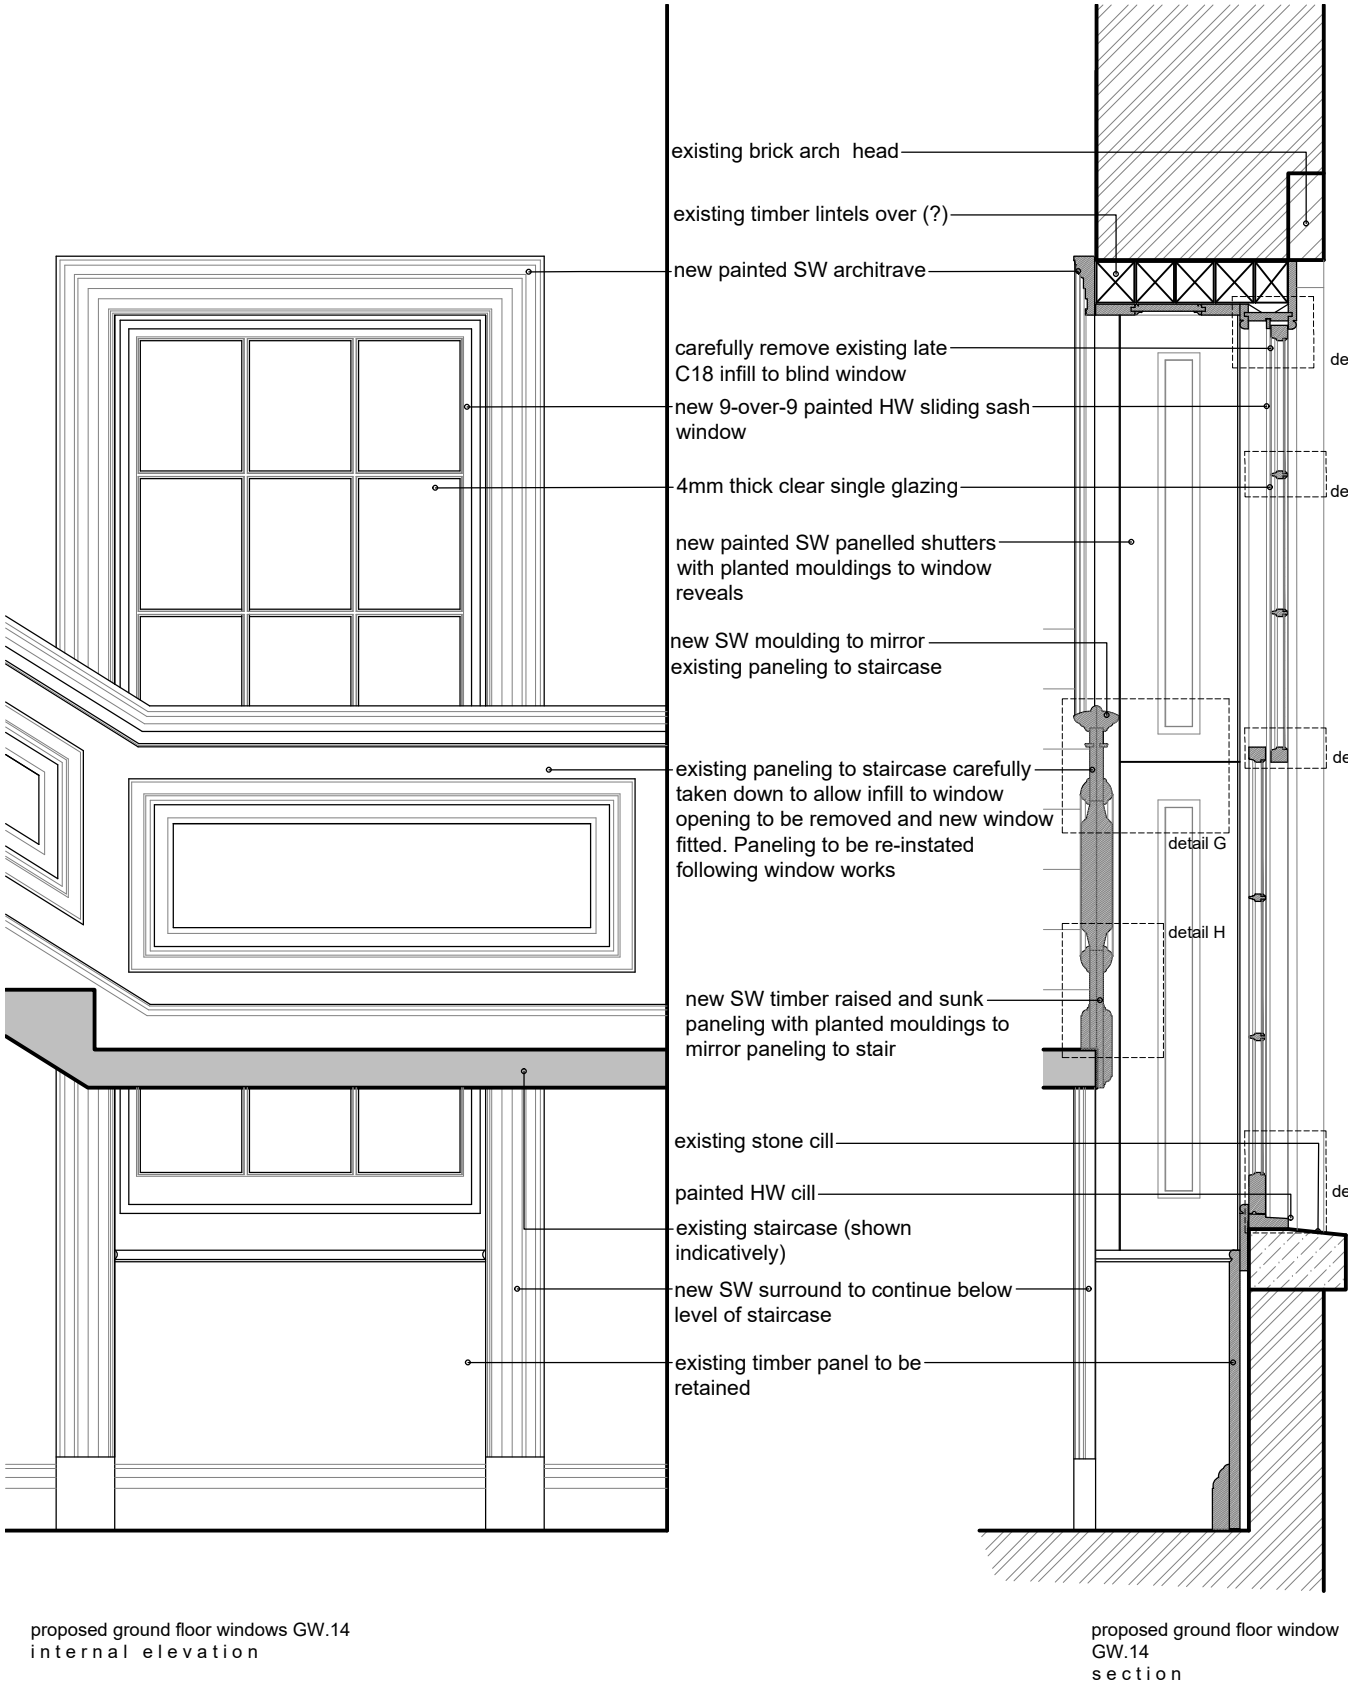


proposed ground floor window GW.14
internal elevation

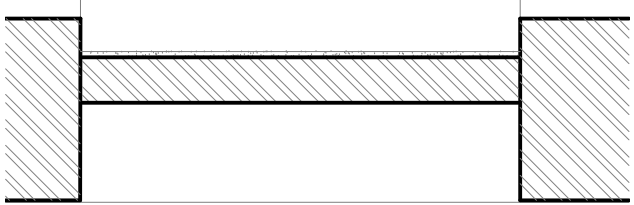


existing ground floor 'blind' windows GW.14
plan

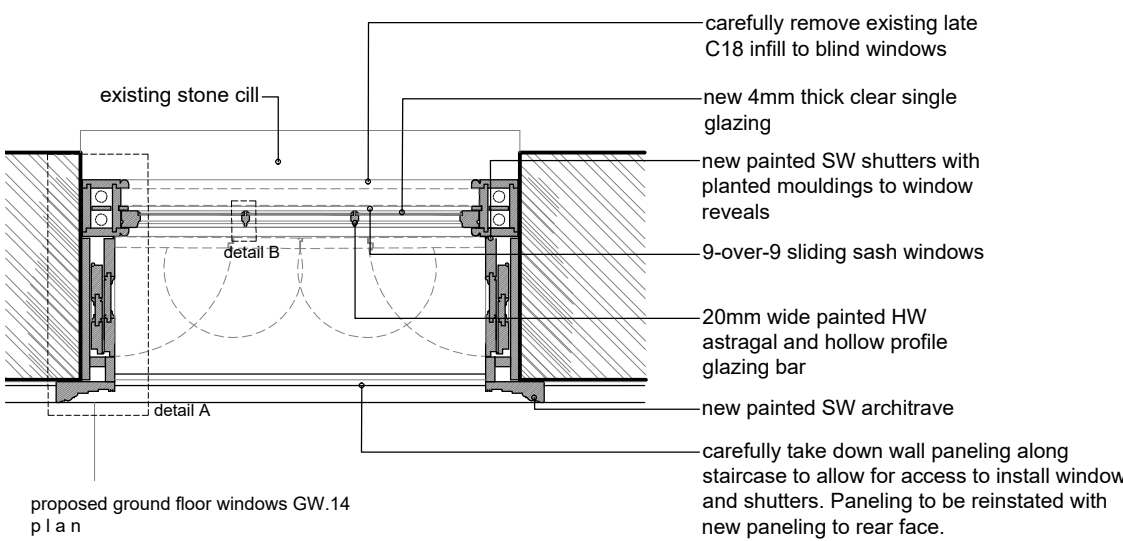


proposed ground floor windows GW.14
plan

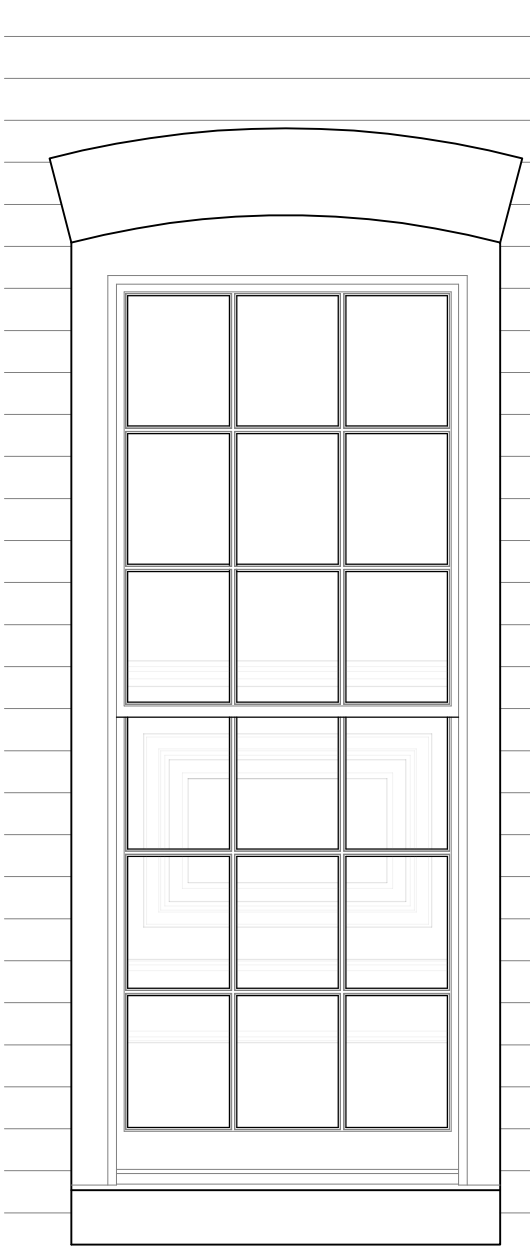


proposed ground floor window GW.14
external elevation

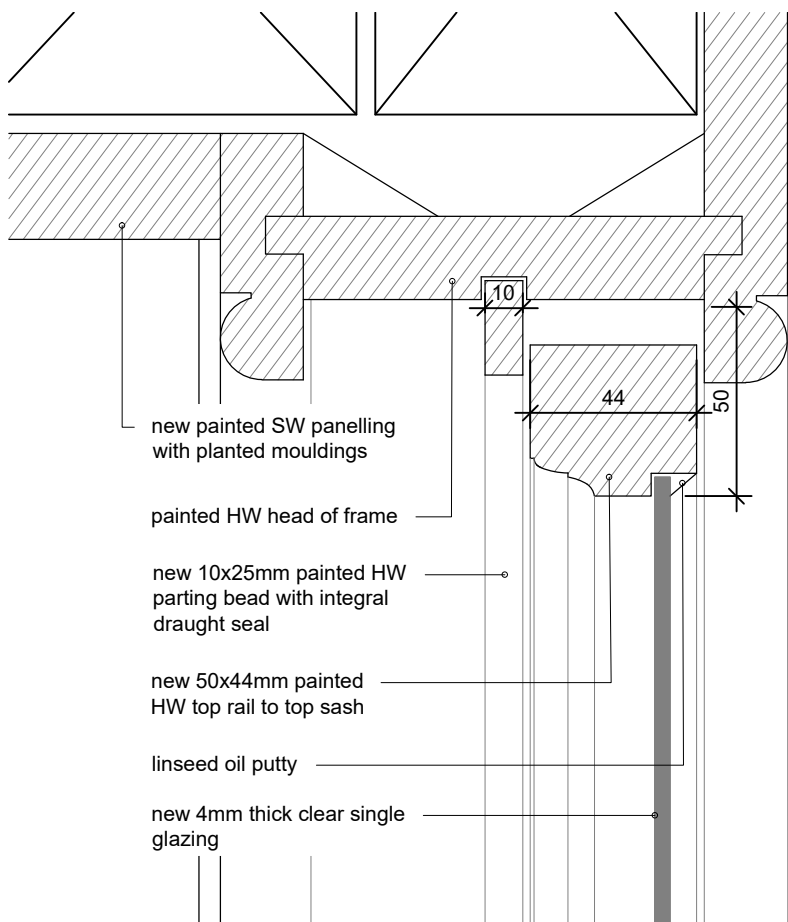


detail C | head detail

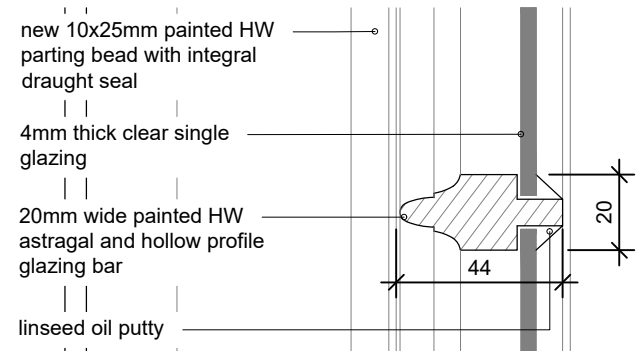


detail D | glazing bar detail

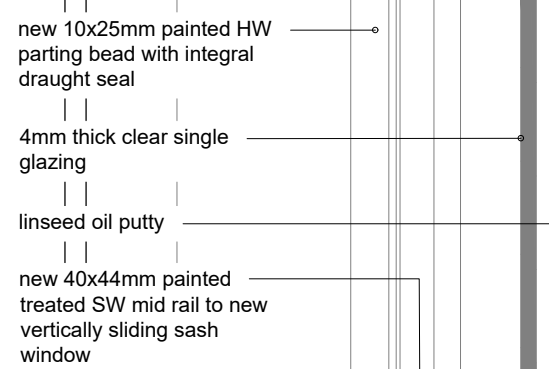


detail E | meeting rail detail

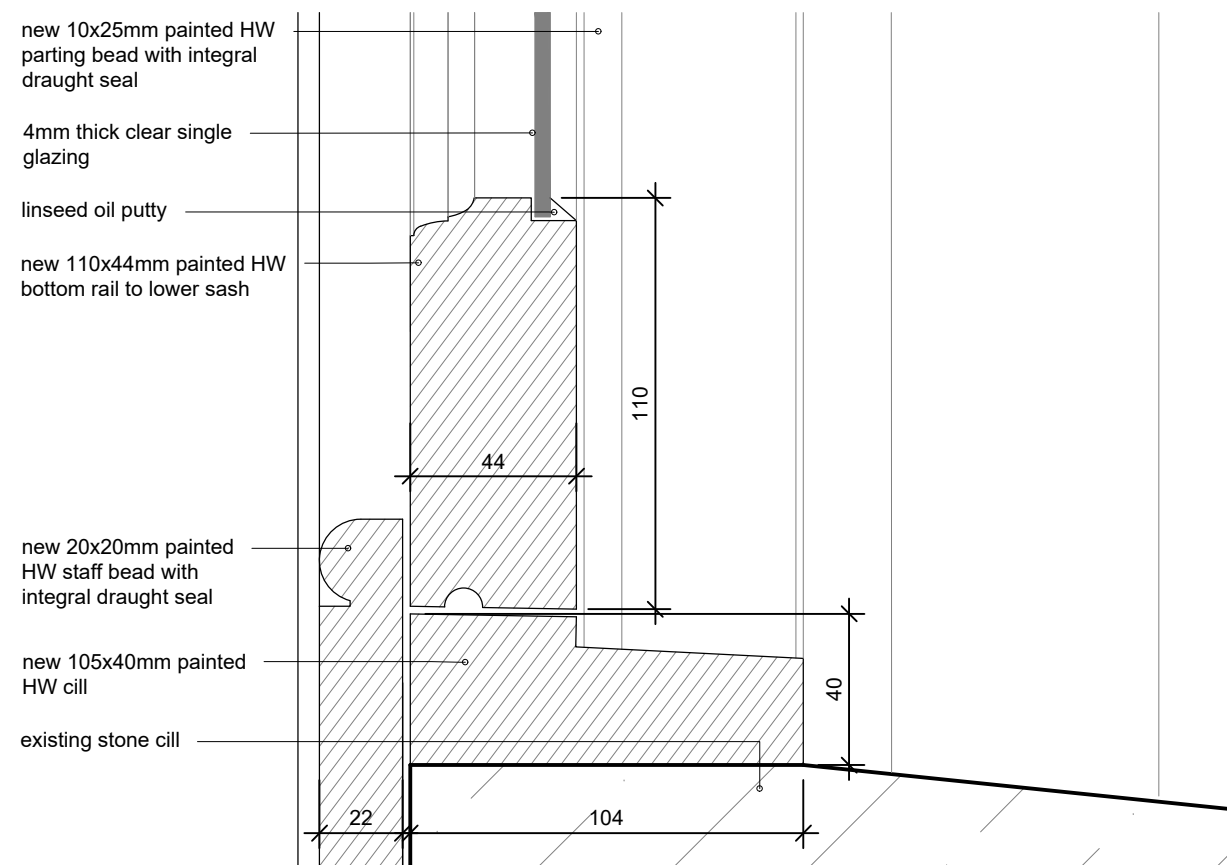


detail F | cill detail

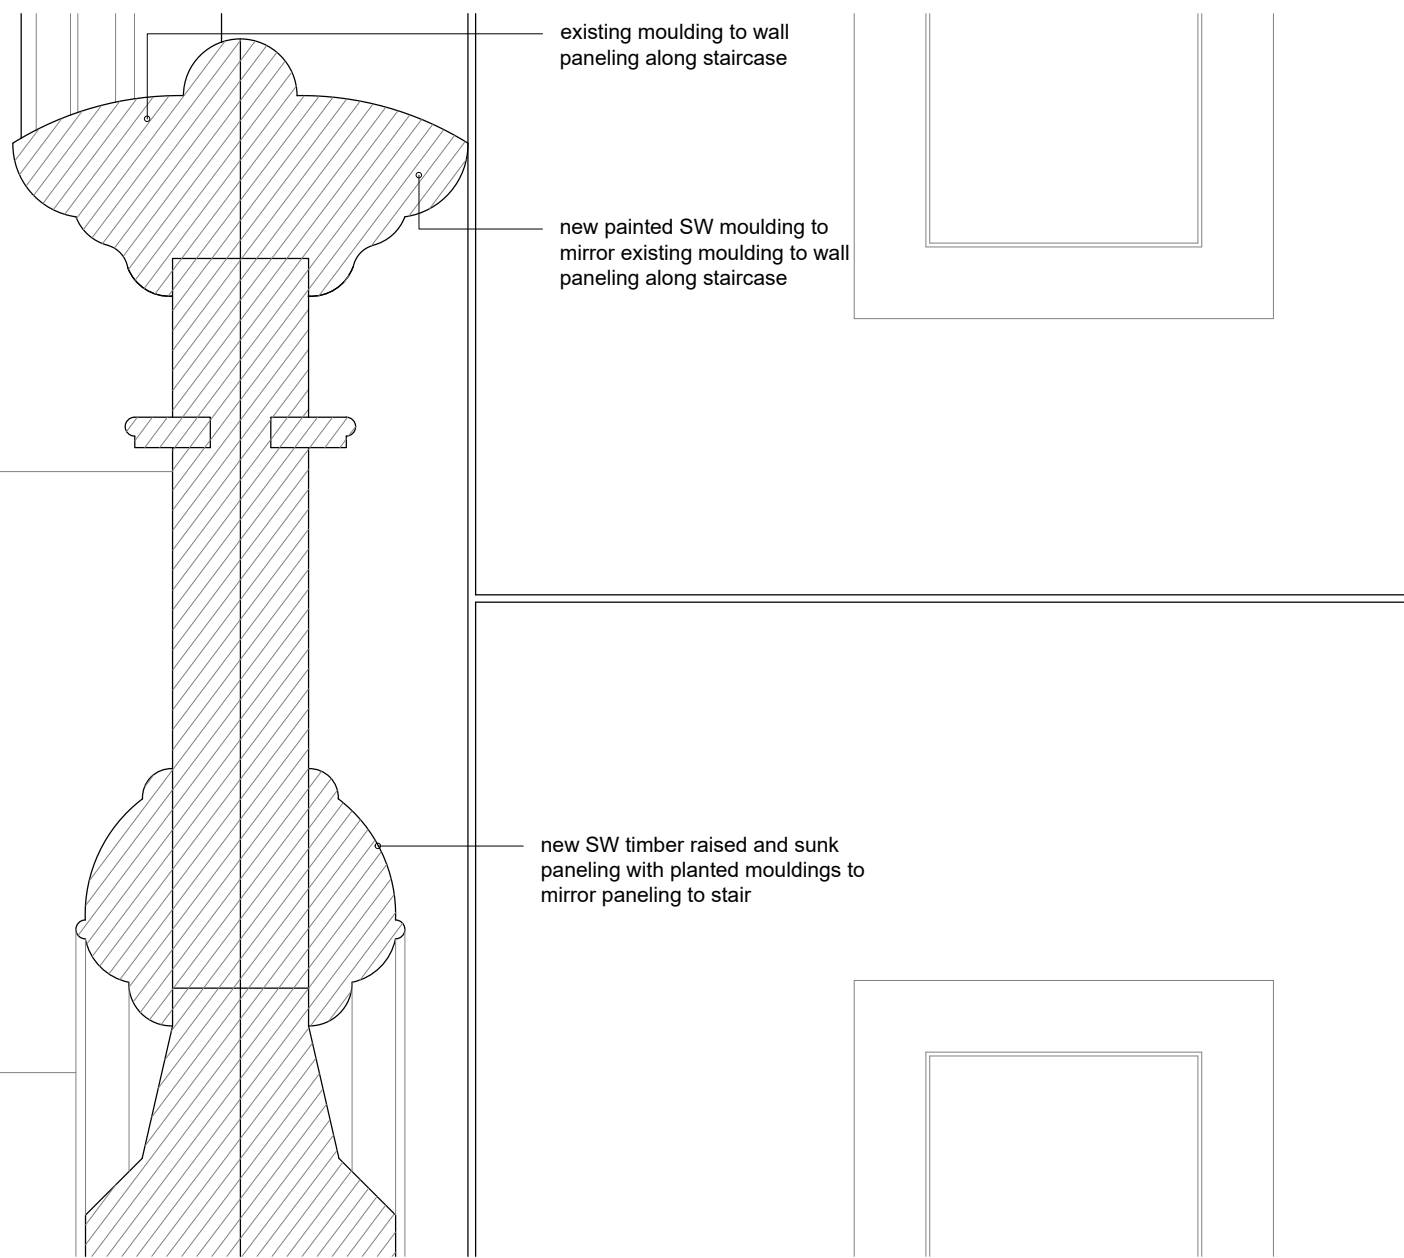


detail G

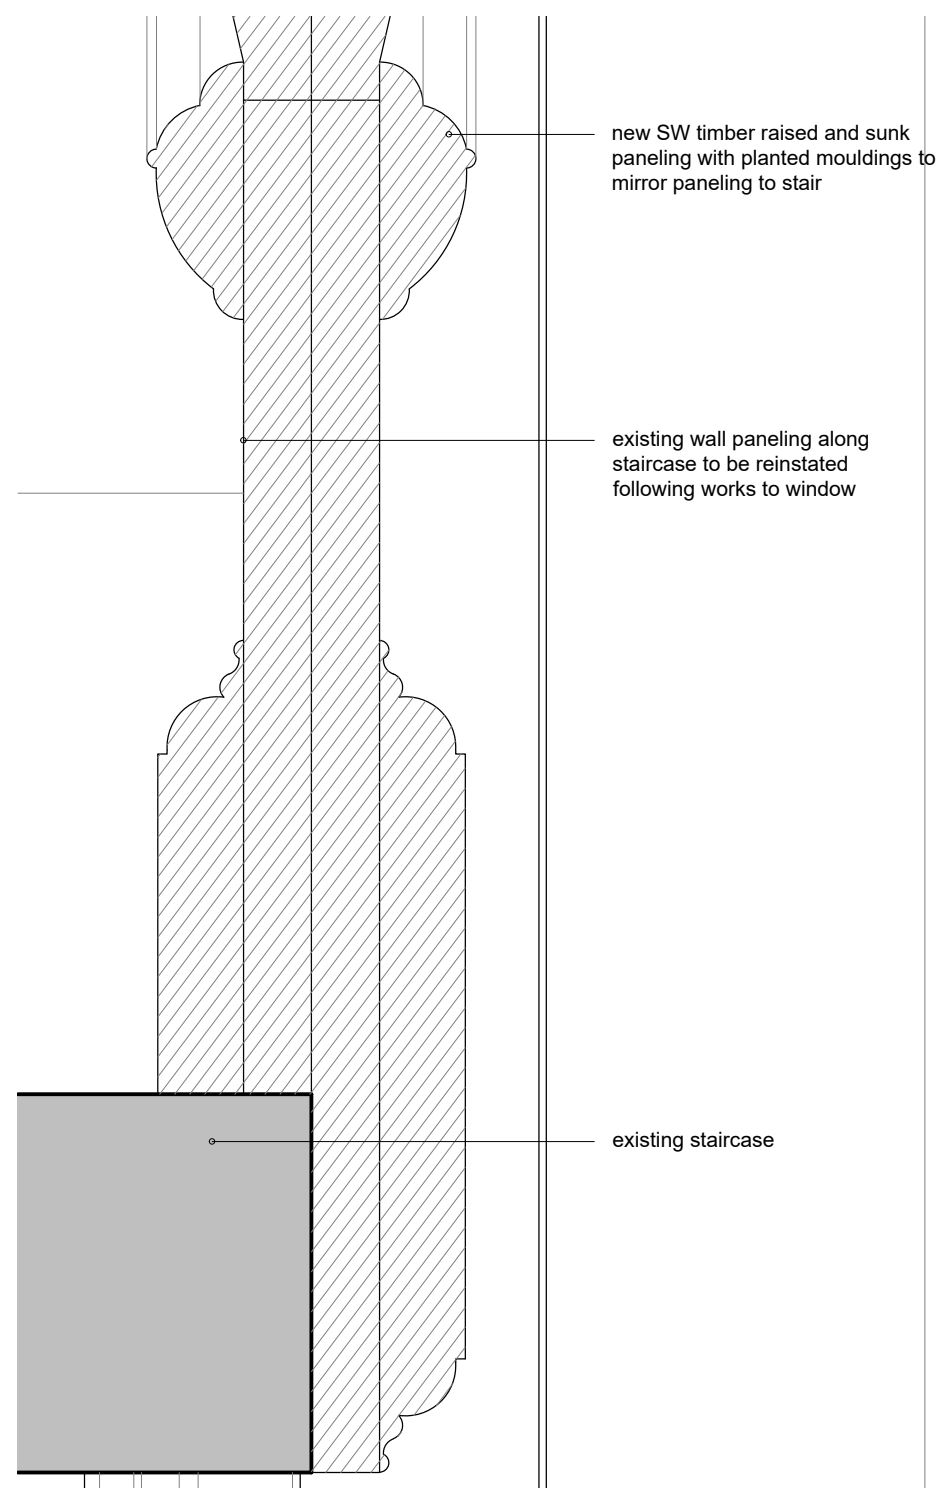

detail H

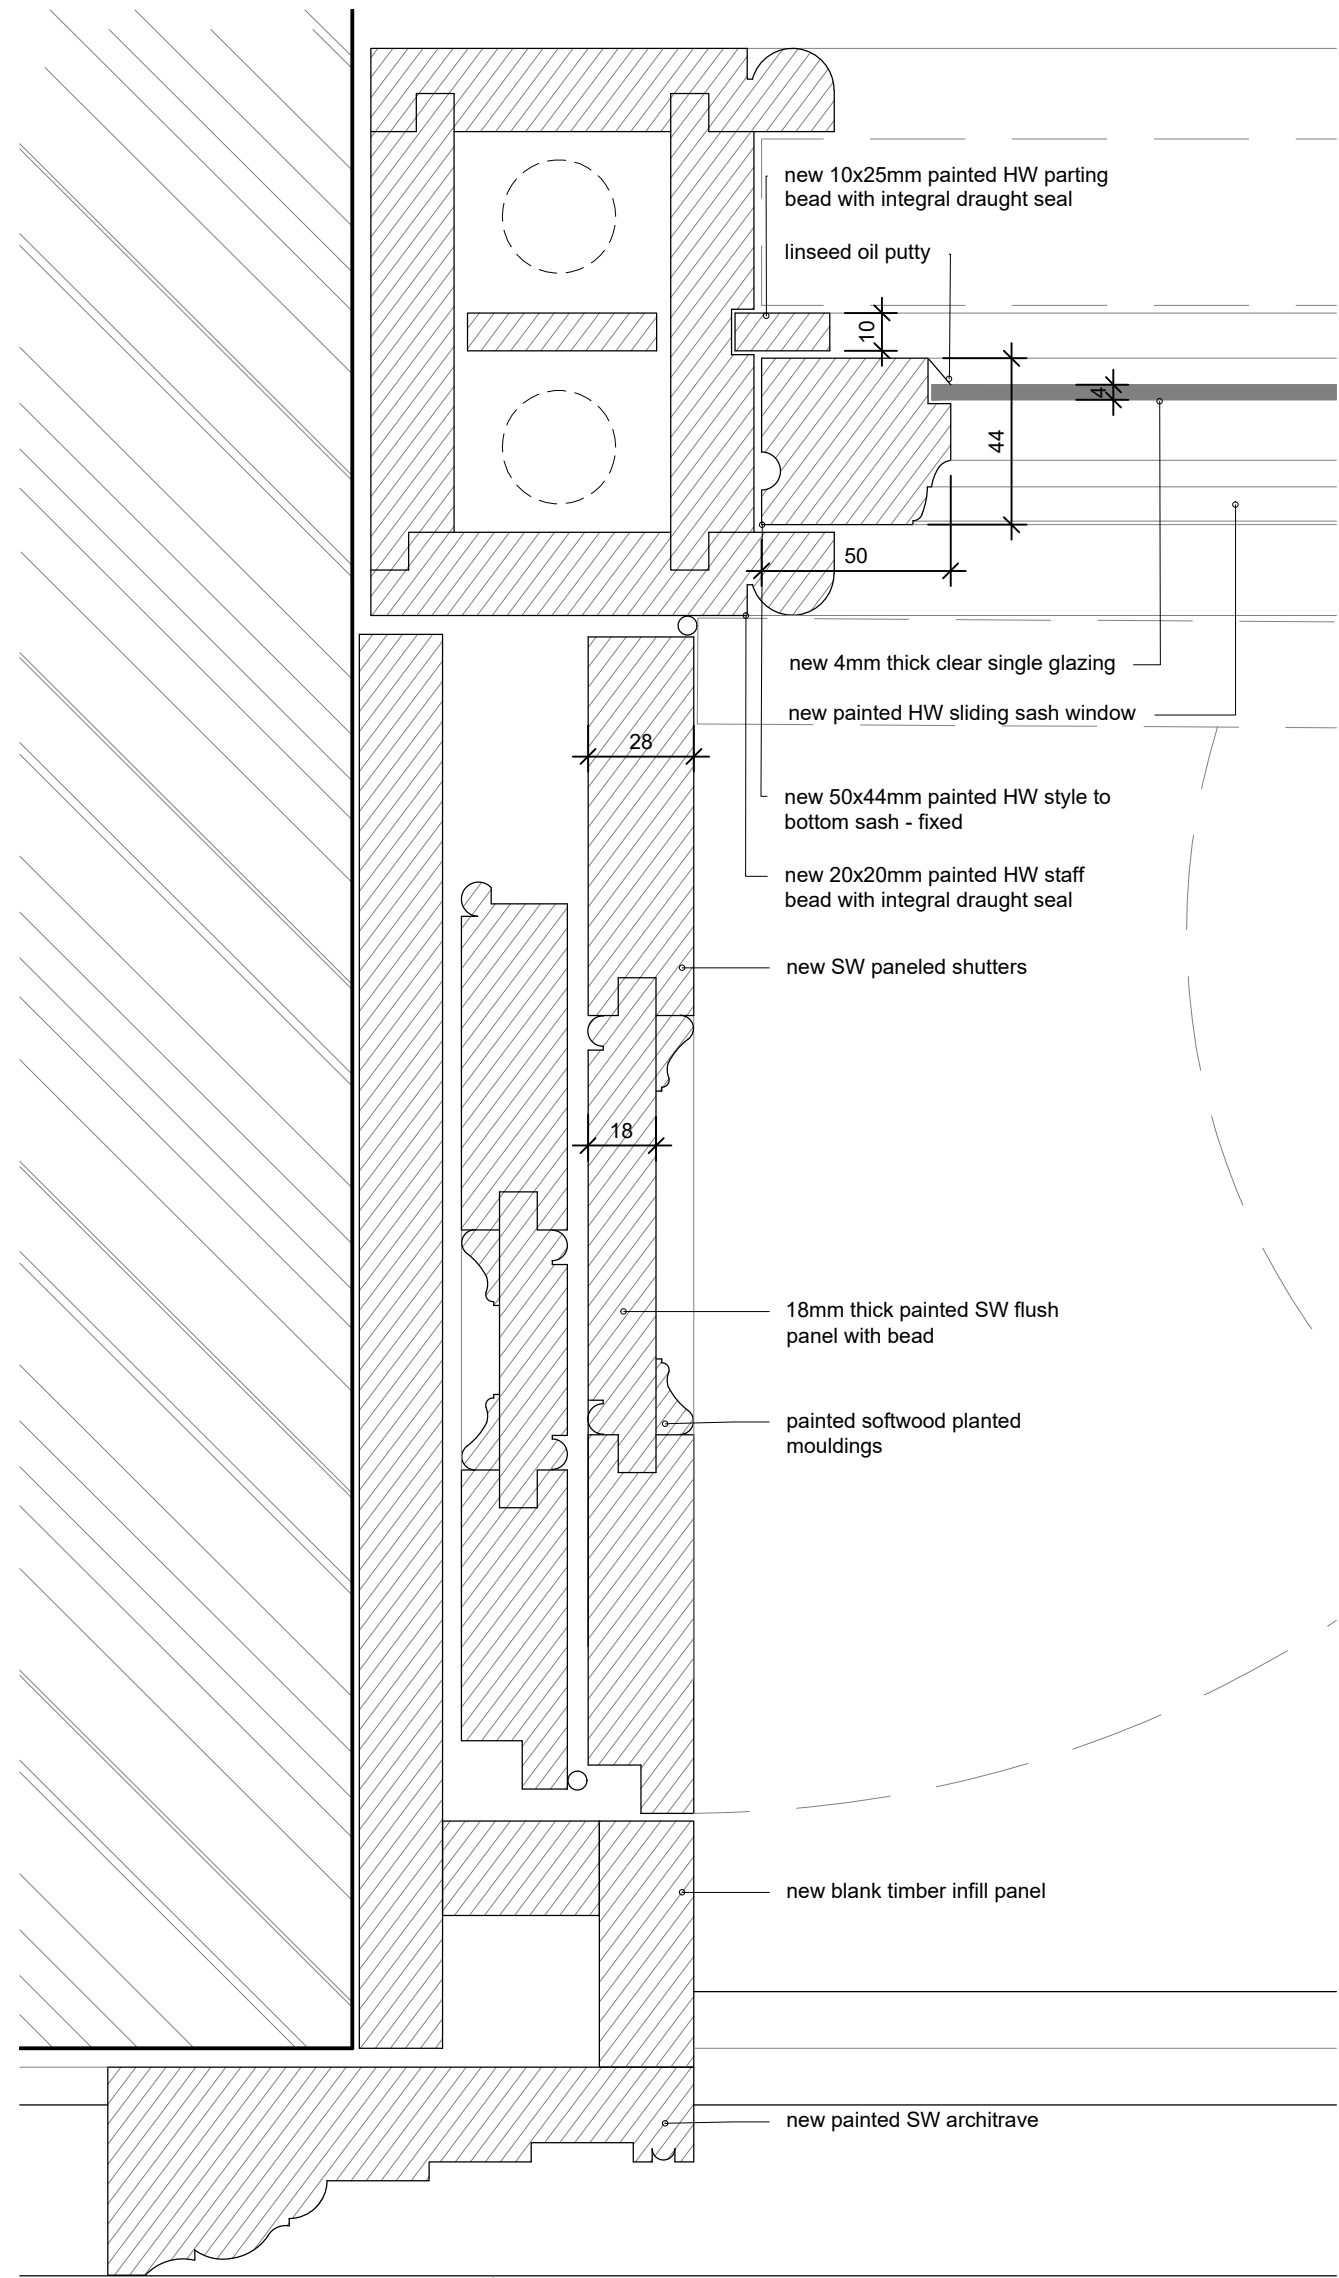

detail A | architrave and shutter detail

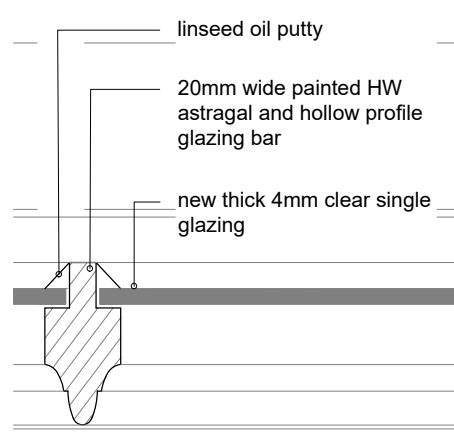

detail B | glazing bar detail

Safety Health and Environmental Information

A1

The following risks are identified as unusual or unfamiliar to a competent contractor

CONSTRUCTION RISKS


There are no significant or unfamiliar risks

DEMOLITION RISKS (FUTURE)

There are no significant or unfamiliar risks

It is assumed that all work will be carried out by a competent contractor working, where appropriate, to an approved method statement

Notes:

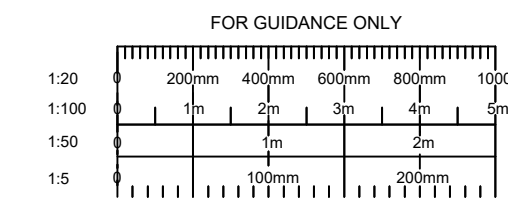

REV DETAILS DATE CHECKED



brownhill hayward brown
chartered architects

01543 254307 - mail@bhbarchitects.co.uk

Repair and Alteration to Walton Hall

Proposed Window Detail GW.14

Mr & Mrs Lyell

PLANNING & LBC

DRAWN
JLL

CHECKED
AM

SCALE
1:20/1:2 @ A1

DRAWING NO
3405-106

REV
B

DATE
Aug '19



The copyright of this drawing and design is vested in the Architect and must not be copied or reproduced without written consent. All dimensions given are to be verified on site by the responsible contractor. Do not scale dimensions from this drawing.

